

## FlashForge FlashPrint

Last Modified on 04.16.26

### Unattended installation

If you want to install FlashPrint silently, there are some extra steps you have to take.

### Prerequisites

- Zhejiang Flashforge 3D Technology software – Normally when you install FlashPrint, you get an extra popup to allow the installation of this device software. If you don't install it, the unattended installation will fail.




- Zhejiang Flashforge 3D Technology Certificate – You must install or inject this certificate. You can obtain this certificate on a machine where FlashPrint is installed.

### Exporting the certificate:

1. Install FlashPrint on a test machine or VM.
2. Start `certmgr.msc`
3. Locate the Zhejiang Flashforge certificate in the **Tusted Publishers > Certificates** section.
4. Double-click the 'Zhejiang Flashforge' certificate.
5. Click the **Details** tab.
6. Click **Copy to file**.
7. Accept the Wizard defaults and choose a location and name for the certificate.
8. Copy the .cer file to a location outside the test machine.

# Recast

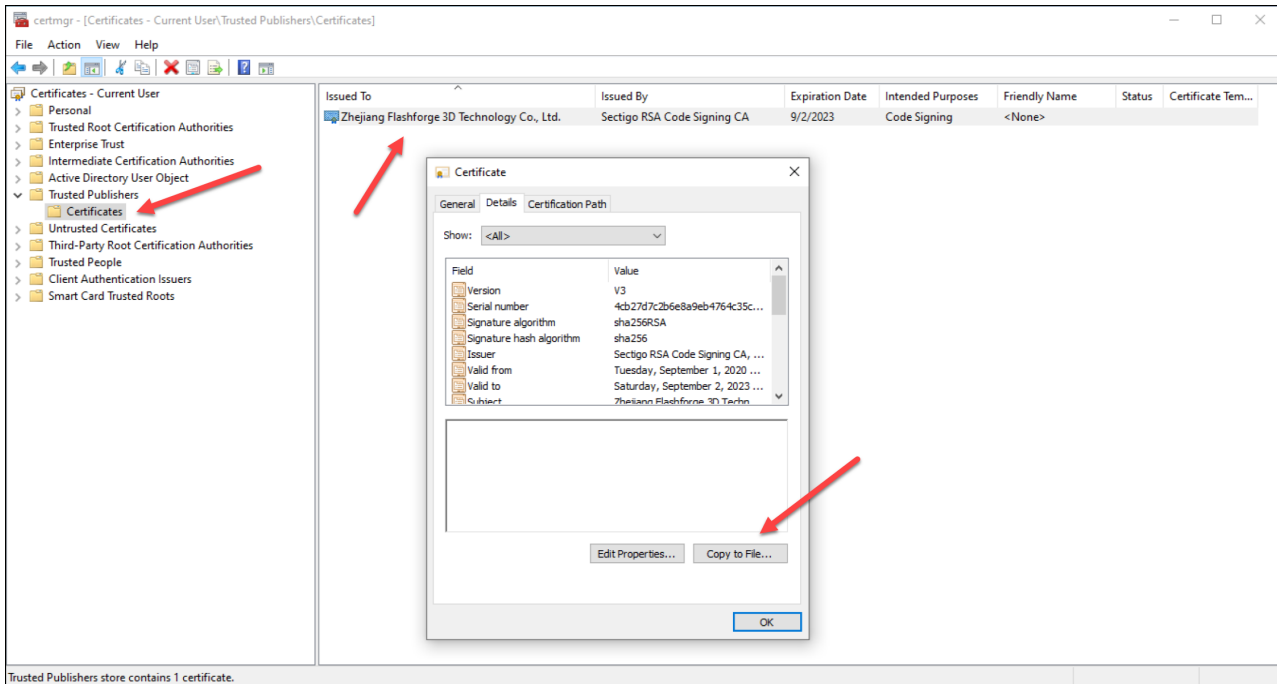

Importing the certificate:

On the machine or image where you want the certificate installed, open an elevated command prompt and type:

```
certutil -addstore TrustedPublisher [drive]\[path]\[certificate]
```

Example: `certutil -addstore TrustedPublisher c:\test\flashprint.cer`

When the certificate is successfully installed, the following message will be displayed:

```
Administrator: Command Prompt

C:\test>certutil -addstore TrustedPublisher c:\test\flashprint.cer
TrustedPublisher "Trusted Publishers"
Certificate "Zhejiang Flashforge 3D Technology Co., Ltd." added to store.
CertUtil: -addstore command completed successfully.

C:\test>
```

You can now do a silent install of FlashPrint.

## Further reading

[FlashPrint Wiki](#)